




**EZ-400-NF-BH-X**  
**3190-6328**




**Type N Female (Jack) Straight Non-Solder Pin No Braid Trim Connector for LMR-400 Cable**

Made in China

## Installation Instruction

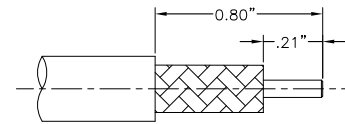

Recommended cable stripping dim's

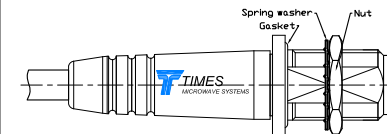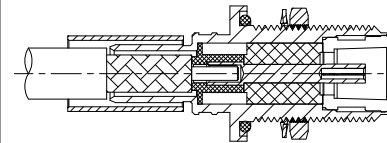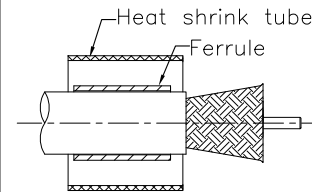

1. A. Cut the cable squarely while keeping it round using the CCT-02 cutting tool.
- B. Trim cable to the dimensions shown using the CST-400 prep tool.
- C. Remove any residual plastic from the center conductor.
- D. Deburr center conductor using the CST-400 or a fine file.

2. A. Slide crimp ferrule and heat shrink tube over the cable.
- B. Flare the braid.

3. A. Insert cable into connector body until dielectric is seated and center conductor is inserted fully into connector center pin.

4. A. Slide crimp ferrule over braid and crimp as close to body as possible using .429" HEX crimp tooling. Pay attention to the crimp area, do not crimp rear of crimp sleeve.
- B. Heat shrink tube over rear of connector body and down on to cable jacket using hot air gun.

Times supply rubber boot 3109-394 (WSB-400) as an option to instead of heat shrink tube.

Refer to [www.timesmicrowave.com](http://www.timesmicrowave.com) for install videos