


3 1 9 0 - 6 0 7 7

TC-400-NMC-2
3190-6077



**Type N Male (Plug) Straight Solder Pin
Clamp Connector for LMR-400 Cable**

Made in China

Installation Instruction

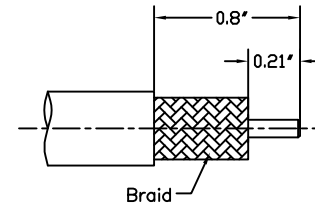

Recommended cable
stripping dim's

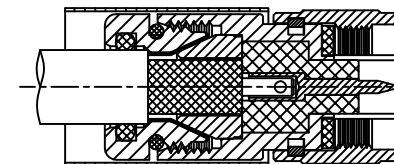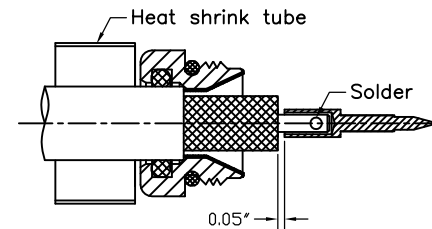

1. A. Trim cable to dimensions shown. Be careful to avoid nicking the braid.
B. Remove any residual plastic from center conductor.
C. Deburr center conductor using a fine file or Times DBT-U tools.
D. Avoid nicking aluminum tape or center conductor.
2. A. Put on the heat shrink tube.
B. Put on the clamp.
C. Turn over the braid.
D. Put on the inner conductor and solder it.
3. A. Put on the connector head.
B. Keep the clamp steady, screw the connector head onto the clamp tightly.
Recommended torque is 10N.m.
C. Heat shrink tube over rear of connector body and down on to cable jacket using hot air gun.